



WESTERN BUS SALES, INC.

Service Flash

Call us toll-free at (800) 258-2473

Edition Date: August 11, 2009

ERRATIC EIGHT LIGHT OPERATION

Products Affected: **Blue Bird Vision or horizontally mounted units**

Complaint-

Erratic electrical operation with the warning lights or any other components tied into those circuits.

Cause-

Weldon flasher mounted "horizontally" with electrical spades upward in a spot where it might be affected by elements of the weather or other "water" intrusion.

Correction-

Check to see if there is water present, Dry and Clean the area around the spades. Remove the flasher and remount "vertically" so that water is not allowed to lie in that area.

WELDON 7000 PART #1656743

