



BLUE BIRD

September 14, 2009

SERVICE MEMORANDUM
NO. SM0902

MEMO TO: All Blue Bird Dealers


SUBJECT: WHEELCHAIR LIFT POWER CABLE ROUTING

MODEL YEAR: 2010

MODELS AFFECTED: VISIONS EQUIPPED WITH CUMMINS ENGINE AND WHEELCHAIR LIFT

The wheelchair lift power cable may be routed too close to the engine exhaust manifold and/or turbocharger on 2010 model year “Vision” buses equipped with a Cummins engine and wheelchair lift delivered from May 29, 2009 through September 09, 2009. **These buses must be inspected immediately to ensure a minimum 6” clearance between the wheelchair lift power cable and engine exhaust manifold and turbocharger.**

Turbocharger

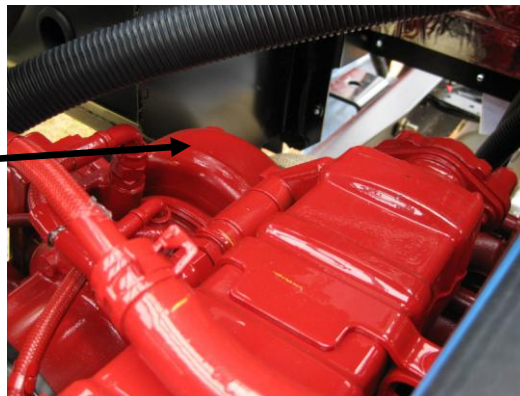

If you have any questions, contact your Field Service Representative.

Sincerely,

Bill Coleman

Bill Coleman
Blue Bird Engineering Services
bill.coleman@blue-bird.com
478-822-2242